# YOUR ONESURVEY HOME REPORT

# ADDRESS

24 Great Glen Place Inverness IV3 8FA

# PREPARED FOR

**Bill & Olive Maxwell** 

**INSPECTION CARRIED OUT BY:** 

SELLING AGENT:

# Harper Macleod Inverness

HOME REPORT GENERATED BY:





# **Document Index**

Document	Status	Prepared By	Prepared On
Index of Documents			
Single Survey	Final	Inverness - Allied Surveyors Scotland Plc	29/04/2022
Mortgage Certificate	Final	Inverness - Allied Surveyors Scotland Plc	29/04/2022
Property Questionnaire	Final	Mr & Mrs. Bill & Olive Maxwell	29/04/2022
EPC	Final	Inverness - Allied Surveyors Scotland Plc	29/04/2022

# **Important Notice:**

This report has been prepared for the purposes and use of the person named on the report. In order to ensure that you have sight of a current and up to date copy of the Home Report it is **essential** that you visit www.onesurvey.org (free of charge) to download a copy personalised in your own name. This enables both Onesurvey and the Surveyor to verify that you have indeed had sight of the appropriate copy of the Home Report prior to your purchasing decision. This personalised report can then be presented to your legal and financial advisers to aid in the completion of your transaction. Failure to obtain a personalised copy may prevent the surveyor having any legal liability to you as they will be unable to determine that you have relied on this report prior to making an offer to purchase.

Neither the whole, nor any part of this report may be included in any published document, circular or statement, nor published in any way without the consent of Onesurvey Ltd. Only the appointed Chartered Surveyor can utilise the information contained herein for the purposes of providing a transcription report for mortgage/loan purposes.



# SINGLE Survey

A report on the condition of the property, with categories being rated from 1 to 3.



# Single Survey

# Survey report on:

Customer	Mr & Mrs. Bill & Olive Maxwell
----------	--------------------------------

Date of Inspection	28/04/2022
--------------------	------------

Prepared by	Graham Laird, BSc (Hons) MRICS Inverness - Allied Surveyors Scotland Plc

### PART 1 - GENERAL

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property. <sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

 $\overline{\mathcal{M}}$ 

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

<sup>&</sup>lt;sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

# 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report. 2

# 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for

expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.10 **DEFINITIONS**

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

# PART 2 – DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, *visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.* 

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not

significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 <u>Category 3</u>: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 <u>Category 2</u>: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 <u>Category 1</u>: No immediate action or repair is needed.

**WARNING**: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- \*There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- \*There are no particularly troublesome or unusual legal restrictions;
- \*There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property

# **1. INFORMATION AND SCOPE OF INSPECTION**

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

Description	End-terraced house.
Accommodation	Ground Floor - entrance hallway, lounge, WC and kitchen/dining room.
	First Floor - landing, bathroom, master bedroom with ensuite and two further bedrooms.
Gross internal floor area (m2)	110 approximately.
Neighbourhood and location	The property is situated in the Great Glen Hall development, incorporating the former Victorian hospital of Craig Dunain. There are a wide range of amenities and facilities available in close proximity.
Age	The hospital was originally constructed in 1864. The subject was converted to a residential property in 2020 approximately.
Weather	Cloudy and dry, following a period of mixed weather.
Chimney stacks	There is a chimney stack of pointed stone construction. Flashings are formed in metal.
	Visually inspected with the aid of binoculars where required.
Roofing including roof space	The roof is of a pitched design, clad with slates. Ridges and valleys are formed in metal. Skews are cement pointed. A limited inspection of the roof space was carried out looking

	up into the hatch. The hatch was not entered. The roof is of timber frame construction with timber sarking boards. There is evidence of an under slate moisture barrier. There is glass wool insulation laid between and across the joists.
	Sloping roofs were visually inspected with the aid of binoculars where required.
Rainwater fittings	Gutters are of an ogee design and appear to be formed in aluminium. Downpipes are of a round design, formed in cast iron.
	Visually inspected with the aid of binoculars where required.
Main walls	The main walls are understood to be of cavity construction, with a timber frame inner load bearing leaf and a concrete blockwork outer leaf, externally rendered. The front facing walls are of pointed sandstone construction.
	Visually inspected with the aid of binoculars where required. Foundations and concealed parts were not exposed or inspected.
Windows, external doors and joinery	Windows are of a double glazed composite timber sash and case style.
	External doors are of a composite timber type with double glazed sections.
	Internal and external doors were opened and closed where keys were available. Random windows were opened and closed where possible. Doors and windows were not forced open.
External decorations	External joinery and rainwater fittings are painted.
	Visually inspected.
Conservatories / porches	None.
Communal areas	There is a shared parking area to the side of the house with two parking spaces allocated to the subject property.
	Circulation areas visually inspected.
Garages and permanent outbuildings	There is an external store in a block of stores at the opposite end of the terrace. The store is of concrete block and stone construction under a slate covered roof. The floor is formed in concrete.
L	

	Visually inspected.
Outside areas and boundaries	There are areas of private garden ground to the front, side and rear of the house, laid to grass.
	Boundaries are defined by small shrubs.
	Visually inspected.
Ceilings	Ceilings are formed in plasterboard.
	Visually inspected from floor level.
Internal walls	Internal walls are of timber stud construction and are lined in plasterboard. There are some tiled finishes.
	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.
Floors including sub floors	The ground floor is of solid concrete construction. The first floor is of suspended timber construction.
	Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.
Internal joinery and kitchen fittings	Internal joinery finishes are formed in timber.
	Internal doors are of a panelled effect ply hollow core type. There are some sliding mirrored wardrobe doors.
	The stairs and railing are formed in timber.
	The kitchen is fitted with a range of floor and wall mounted laminate finished composite timber units.
	Built-in cupboards were looked into but no stored items were moved. Kitchen units were visually inspected excluding appliances.
Chimney breasts and fireplaces	None.
Internal decorations	Walls and ceilings are painted.
	Visually inspected.
Cellars	None.
Electricity	Mains supply. Visible wiring is run in PVC coated cabling

	with 12 own outlate	
	with 13 amp outlets.	
	The electricity meter and circuit breakers are located in the cupboard by the front door.	
	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.	
Gas	Mains supply. The meter is located externally by the kitchen door.	
	Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.	
Water, plumbing and bathroom fittings	Mains supply. Visible pipework is formed in copper, uPVC and braided steel.	
	The bathroom is fitted with a white suite comprising bath with electric shower fitting over, toilet and wash hand basin.	
	The ensuite is fitted with a white suite comprising mixer shower cubicle, toilet and wash hand basin.	
	There is a stainless steel sink unit fitted in the kitchen.	
	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation. No tests whatsoever were carried out to the system or appliances.	
Heating and hot water	There is a Worcester Greenstar 8000 Life gas fired combination central heating boiler, located in a cupboard in the kitchen. This is connected to steel panel radiators distributed throughout the property and also provides domestic hot water.	
	The heating system is zone controlled, with the ground and first floors having independent programmers and thermostats. There are also individual thermostatic valves	

	fitted on radiators.
	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected. No tests whatsoever were carried out to the system or appliances.
Drainage	Drainage is to the mains.
	Drainage covers etc were not lifted. Neither drains nor drainage systems were tested.
Fire, smoke and burglar alarms	There are smoke detectors fitted in the hallway, in the lounge and on the landing. There is a heat detector and a carbon monoxide detector fitted in the kitchen.
	Visually inspected. No tests whatsoever were carried out to the system or appliances.
	The new Fire and Smoke Alarm Standard came in to force in February 2022. This new standard requires a smoke alarm to be installed in the room most frequently used for living purposes and in every circulation space on each floor. A heat alarm also needs to be installed in each kitchen. The alarms need to be ceiling mounted and interlinked. Where there is a carbon-fuelled appliance such as a boiler, open fire or wood burner a carbon monoxide detector is also required. The purchaser should satisfy themselves in this regard.
Any additional limits to inspection	The property is occupied, fully furnished and all floors are covered. Random testing for dampness was undertaken internally with the use of a moisture meter where accessible and considered appropriate. Parts of the property which are covered, unexposed or inaccessible cannot be guaranteed to be free from defect. Inspection of the roof space was restricted to areas visible looking up into the hatch. Inspection was restricted by the presence of insulation material. I have not disturbed insulation in accordance with Health & Safety guidelines and furniture, personal effects (particularly in cupboards) and floor coverings have not been moved.
	I did see below the bath or shower tray.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled manner by specialist contractors. This can prove to be expensive.

# Sectional Diagram showing elements of a typical house



Coping stone (2) Chimney head (3) Flashing (4)**Ridge ventilation** (5) Ridge board (6) Slates / tiles ി Valley guttering (8) (9) Dormer projection (10) Dormer flashing (11) Dormer cheeks (12) Sarking (13) Roof felt (14) Trusses (15) Collar (16) Insulation (17) Parapet gutter (18) Eaves guttering (19) Rainwater downpipe Verge boards/skews 20 Soffit boards (21) Partiton wall (22) Lath / plaster (23) (24) Chimney breast Window pointing (25) Window sills (26) Rendering (27) (28) Brickwork / pointing (29) Bay window projection (30) Lintels (31) Cavity walls / wall ties (32) Subfloor ventilator (33) Damp proof course Base course 34) Foundations (35) Solum (36) Floor joists (37) Floorboards 38) Water tank (39)

Chimney pots

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items. 40 Hot water tank

# 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Structural movement		
Repair category:		
Notes:	No reportable defects.	

Dampness, rot and infestation		
Repair category:		
Notes:	No reportable defects.	

Chimney stacks		
Repair category:		
Notes:	No reportable defects.	

Roofing including roof space		
Repair category:		
Notes:	No reportable defects.	

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Rainwater fittings		
Repair category:		
Notes:	No reportable defects.	

Main walls		
Repair category:		
Notes:	No reportable defects.	

Windows, external doors and joinery		
Repair category:		
Notes:	No reportable defects.	

External decorations		
Repair category:		
Notes:	No reportable defects.	

Conservatories / porches			
Repair category:			
	Not applicable.		

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Notes:		

Communal areas	
Repair category:	
Notes:	No reportable defects.

Garages and permanent outbuildings	
Repair category:	
Notes:	No reportable defects.

Outside areas and boundaries	
Repair category:	
Notes:	No reportable defects.

Ceilings	
Repair category:	
Notes:	No reportable defects.

# Internal walls

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Repair category:	1
Notes:	No reportable defects.

Floors including sub-floors	
Repair category:	
Notes:	No reportable defects.

Internal joinery and kitchen fittings	
Repair category:	
Notes:	No reportable defects.

Chimney breasts and fireplaces	
Repair category:	
Notes:	Not applicable.

Internal decorations	
Repair category:	
Notes:	No reportable defects.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Cellars	
Repair category:	
Notes:	Not applicable.

Electricity	
Repair category:	
Notes:	No visual defects identified.
	The system was safety checked in November 2019.
	It should be emphasised that the system was not tested at the time of our inspection. The Institution of Engineering and Technology recommends that inspections and testing are undertaken at least every ten years and on a change of occupancy.

Gas	
Repair category:	1
Notes:	No visual defects identified.

Water, plumbing	and bathroom fittings
Repair category:	
Notes:	No visual defects identified.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Heating and hot	water
Repair category:	
Notes:	No visual defects identified.
	Gas central heating systems should be serviced annually by a Gas Safe registered engineer to ensure they run safely and efficiently.

Drainage	
Repair category:	
Notes:	No visual defects identified.

Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	1
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories / porches	
Communal areas	1
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	
Internal decorations	1
Cellars	
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

# Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

# Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# **3. ACCESSIBILITY INFORMATION**

# **Guidance Notes on Accessibility Information**

<u>Three steps or fewer to a main entrance door of the property</u>: In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

<u>Unrestricted parking within 25 metres</u>: For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coinoperated machines.

1. Which floor(s) is the living accommodation on?	Ground and first.
2. Are there three steps or fewer to a main entrance door of the property?	[x]YES [ ]NO
3. Is there a lift to the main entrance door of the property?	[ ]YES [x]NO
4. Are all door openings greater than 750mm?	[x]YES [ ]NO
5. Is there a toilet on the same level as the living room and kitchen?	[x]YES [ ]NO
6. Is there a toilet on the same level as a bedroom?	[x]YES [ ]NO
7. Are all rooms on the same level with no internal steps or stairs?	[]YES [x]NO
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	[x]YES [ ]NO

# 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

# Matters for a solicitor or licensed conveyancer

Absolute Ownership assumed. We are unaware of any easements, servitudes or rights of way which may adversely affect the property. This point should be confirmed by reference to the Title Deeds.

It is understood there are factoring charges associated with the development.

The valuation is inclusive of areas of private garden ground to the front, side and rear, along with a private store and two allocated parking spaces.

The development is Category B listed.

The insurance figure below pertains to the house and store only and does not include any allowance for the communal areas.

# Estimated re-instatement cost (£) for insurance purposes

£410,000 (FOUR HUNDRED AND TEN THOUSAND POUNDS) Building costs are currently increasing significantly above inflation due to material and labour shortages as well as Brexit and the Pandemic. It is recommended that you update this figure regularly to ensure that you have adequate cover or alternatively seek specialist advice from your insurer.

# Valuation (£) and market comments

£280,000 (TWO HUNDRED AND EIGHTY THOUSAND POUNDS) The property is considered to be a reasonable purchase at or around the above noted valuation based on those matters covered within this report.

Our valuation reflects current market conditions relating to this area. We would assume that current trends will prevail at the ultimate date of disposal with no adverse or onerous matters being introduced into the market during the intervening period which would have a detrimental effect on price.

Report author:	Graham Laird, BSc (Hons) MRICS
Company name:	Inverness - Allied Surveyors Scotland Plc
Address:	Pavilion1 Fairways Business Park

	Inverness IV2 6AA
Signed:	Electronically Signed: 205130-328c9da1-c3fb
Date of report:	29/04/2022

### PART 2.

# MORTGAGE VALUATION REPORT

Includes a market valuation of the property.



ODESURVEY HOME REPORT							
Mortgage Valuation Report							
Property:	24 Great Glen PlaceClient: Mr & Mrs. Bill & Olive MaxwellInvernessTenure: Absolute Ownership						
Date of Inspection:	28/04/2022		Reference:	I/22/2625/GL	/KMC		
purpose of this for mortgage pu- should not rely Your attention i service provide accordance wit named client or contents. Neith	This report has been prepared as part of your instructions to carry out a Single Survey on the property referred to above. The purpose of this report is to summarise the Single Survey for the purpose of advising your lender on the suitability of the property for mortgage purposes. The decision as to whether mortgage finance will be provided is entirely a matter for the lender. You should not rely on this report in making your decision to purchase but consider all the documents provided in the Home Report. Your attention is drawn to the additional comments elsewhere within the report which set out the extent and limitations of the service provided. This report should be read in conjunction with the Single Survey Terms and Conditions (with MVR). In accordance with RICS Valuation – Global Standards 2017 this report is for the use of the party to whom it is addressed or their named client or their nominated lender. No responsibility is accepted to any third party for the whole or any part of this report may be included in any document, circular or statement without prior approval in writing from the surveyor.						
1.0	LOCATION						
The property i	L s situated in the		Il development, lities available i		he former Victo ty.	rian hospital of	Craig Dunain.
The property i	L s situated in the	enities and faci	•				Craig Dunain.
The property i There are a w	s situated in the ide range of am DESCRIPTIO	enities and faci	•	n close proximi	ty.		Craig Dunain.
The property i There are a w <b>2.0</b>	s situated in the ide range of am DESCRIPTIO	enities and faci	•	n close proximi	ty.		Craig Dunain.
The property is There are a w <b>2.0</b> End-terraced I <b>3.0</b> Walls are of ca front walls are	s situated in the ide range of am DESCRIPTIO nouse. CONSTRUCT avity construction of stone construction	nenities and faci N FION on with a timber	lities available in frame inner loa f is pitched and	n close proximi <b>2.1 Age:</b> d bearing leaf a	ty.	proximately.	
The property is There are a w <b>2.0</b> End-terraced I <b>3.0</b> Walls are of ca front walls are	s situated in the ide range of am DESCRIPTIO nouse. CONSTRUCT avity construction of stone construction	rion with a timber ruction. The roo spended timber	lities available in frame inner loa f is pitched and	n close proximi <b>2.1 Age:</b> d bearing leaf a	ty. Built 2020 app	proximately.	
The property is There are a w <b>2.0</b> End-terraced I <b>3.0</b> Walls are of ca front walls are Floors are of c <b>4.0</b>	s situated in the ide range of am DESCRIPTIO nouse. CONSTRUCT avity construction of stone construction of stone construction ACCOMMOD	FION TON Ton with a timber fuction. The roo spended timber	lities available in frame inner loa f is pitched and	n close proximi <b>2.1 Age:</b> d bearing leaf a slated.	ty. Built 2020 app	proximately.	
The property is There are a w <b>2.0</b> End-terraced I <b>3.0</b> Walls are of ca front walls are Floors are of ca <b>4.0</b> Ground Floor	s situated in the ide range of am DESCRIPTIO nouse. CONSTRUCT avity construction of stone construc- concrete and su ACCOMMOD - entrance hallw	FION FION on with a timber fuction. The roo spended timber ATION vay, lounge, WC	lities available in frame inner loa f is pitched and construction.	n close proximi 2.1 Age: d bearing leaf a slated. ning room.	ty. Built 2020 app and a concrete I	proximately.	
The property is There are a w <b>2.0</b> End-terraced I <b>3.0</b> Walls are of ca front walls are Floors are of ca <b>4.0</b> Ground Floor	s situated in the ide range of am DESCRIPTIO nouse. CONSTRUCT avity construction of stone construction of ston	rion rion with a timber fuction. The roo spended timber ATION vay, lounge, WC n, master bedro	frame inner loa f is pitched and construction.	n close proximi 2.1 Age: d bearing leaf a slated. ning room. e and two furthe	ty. Built 2020 app and a concrete l	proximately.	
The property in There are a w <b>2.0</b> End-terraced I <b>3.0</b> Walls are of ca front walls are Floors are of co <b>4.0</b> Ground Floor - First Floor - la	s situated in the ide range of am DESCRIPTIO nouse. CONSTRUCT avity construction of stone construction of ston	rion rion with a timber fuction. The roo spended timber ATION vay, lounge, WC n, master bedro	lities available in frame inner loa f is pitched and construction.	n close proximi 2.1 Age: d bearing leaf a slated. ning room. e and two furthe	ty. Built 2020 app and a concrete l	proximately.	
The property is There are a w 2.0 End-terraced I 3.0 Walls are of ca front walls are Floors are of c 4.0 Ground Floor First Floor - la 5.0	s situated in the ide range of am <b>DESCRIPTIO</b> nouse. CONSTRUCT avity construction of stone construction of stone construction concrete and su ACCOMMOD - entrance hallweithing, bathroon SERVICES (Mains	rion rion on with a timber ruction. The roo spended timber ATION vay, lounge, WC n, master bedro No tests have to	lities available in frame inner loa f is pitched and construction. C and kitchen/dii om with ensuite <b>been applied to</b> Mains	and two furthe	ty. Built 2020 app and a concrete l er bedrooms. <b>rvices)</b>	proximately.	r leaf. The

Garage:		None				
Others:		Concrete block/stone and slate external store.				
7.0	of any woodw The report can defects, partic Where defects accurate estin	<b>AL CONDITION -</b> A building survey has not been carried out, nor has any inspection been made bodwork, services or other parts of the property which were covered, unexposed or inaccessible. In transition therefore confirm that such parts of the property are free from defect. Failure to rectify barticularly involving water penetration may result in further and more serious defects arising. Effects exist and where remedial work is necessary, prospective purchasers are advised to seek estimates and costings from appropriate Contractors or Specialists before proceeding with the e. Generally we will not test or report on boundary walls, fences, outbuildings, radon gas or site mation.				
The house ha and externally		ed in a good sta	ate of repair for	a property of its age, type and	construction bo	oth internally
8.0	ESSENTIAL I property)	REPAIR WORK	(as a condition	o of any mortgage or, to preser	ve the condition	of the
None.						
8.1 Retention	n recommended	1:	Not applicable			
9.0	ROADS &FO	OTPATHS				
Made up and	adopted.					
10.0	BUILDINGS I (£):	NSURANCE	410,000	GROSS EXTERNAL FLOOR AREA	168	Square metres
11.0	This figure is an opinion of an appropriate sum for which the property and substantial outbuildings should be insured against total destruction on a re-instatement basis assuming reconstruction of the property in its existing design and materials. Furnishings and fittings have not been included. No allowance has been included for inflation during the insurance period or during re-construction and no allowance has been made for VAT, other than on professional fees. Further discussions with your insurers is advised.					
	GENERAL RI			ments, servitudes or rights of v		
affect the prop It is understoo The valuation two allocated The developm	perty. This point od there are factor is inclusive of a parking spaces. nent is Category	should be confi oring charges a reas of private o B listed.	irmed by referer ssociated with t garden ground t	he development. o the front, side and rear, alon	g with a private	store and
12.0	<b>VALUATION</b> On the assumption of vacant possession and that the property is unaffected by any adverse planning proposals, onerous burdens, title restrictions or servitude rights. It is assumed that all necessary Local Authority consents, which may have been required, have been sought and obtained. No investigation of any contamination on, under or within the property has been made as we consider such matters to be outwith the scope of this report. All property built prior to the year 2000 may contain asbestos in one or more of its components or fittings. It is impossible to identify without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask for a specialist to undertake appropriate tests.					
12.1	Market Value condition (£)		280,000	TWO HUNDRED AND EIGHTY THOUSAND POUNDS.		D POUNDS.
12.2	Market Value completion o		N/A	N/A		

	works (£):					
12.3 Suitable security for normal mortgage purposes?		Yes				
12.4	12.4 Date of Valuation:		28/04/2022			
Signature: Electronically		Signed: 205130-328c9da1-c3fb				
Surveyor:	Surveyor: Graham Laird		BSc (Hons) M	IRICS	Date:	29/04/2022
Inverness - Allied Surveyors Scotland Plc						
Office:	Office: Pavilion1 Fairways Business Park Inverness IV2 6AA		Tel: 01463 239 494 Fax: email: inverness@alliedsu	rveyorsscotlar	ıd.com	



# ENERGY **Report**

A report on the energy efficiency of the property.



# energy report

# energy report on:

-

-

Property address	24 Great Glen Place Inverness IV3 8FA
------------------	---

-

-

Customer	Mr & Mrs. Bill & Olive Maxwell
----------	--------------------------------

Inv	Great Glen Place verness 3 8FA
-----	--------------------------------------

Prepared by	Graham Laird, BSc (Hons) MRICS Inverness - Allied Surveyors Scotland Plc
Prepared by	,

# **Energy Performance Certificate (EPC)**

# Scotland

Dwellings

#### 24 GREAT GLEN PLACE, INVERNESS, IV3 8FA

Dwelling type:	End-terrace house
Date of assessment:	28 April 2022
Date of certificate:	29 April 2022
Total floor area:	110 m²
Primary Energy Indicator:	162 kWh/m <sup>2</sup> /year

#### **Reference number:** Type of assessment: Approved Organisation: Main heating and fuel:


0182-2708-1543-2722-3225 RdSAP, existing dwelling Elmhurst Boiler and radiators, mains gas

#### You can use this document to:


- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£2,067	See your recommendations
Over 3 years you could save*	£72	report for more information

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

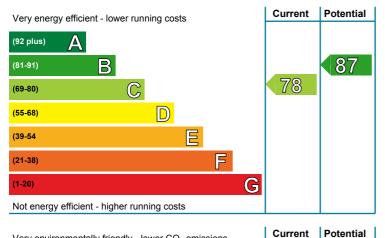

Very environmentally friendly - lower CO<sub>2</sub> emissions

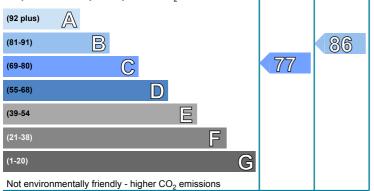

# **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is band C (78). The average rating for EPCs in Scotland is band D (61).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

# Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide  $(CO_2)$ emissions. The higher the rating, the less impact it has on the environment.

Your current rating is **band C (77)**. The average rating for EPCs in Scotland is band D (59).

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

# Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Solar water heating	£4,000 - £6,000	£72.00
2 Solar photovoltaic (PV) panels	£3,500 - £5,500	£912.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE **DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE** 

# Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed) Sandstone or limestone, as built, insulated (assumed)	*****	***** *****
Roof	Pitched, 400+ mm loft insulation	****	*****
Floor	Solid, insulated (assumed)	—	
Windows	Fully double glazed	****☆	<b>★★★</b> ☆
Main heating	Boiler and radiators, mains gas	****☆	<b>★★★</b> ☆
Main heating controls	Time and temperature zone control	****	*****
Secondary heating	None	—	_
Hot water	From main system	****☆	<b>★★★</b> ☆
Lighting	Low energy lighting in all fixed outlets	****	*****

# The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

# The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 28 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 3.1 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.9 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## 24 GREAT GLEN PLACE, INVERNESS, IV3 8FA 29 April 2022 RRN: 0182-2708-1543-2722-3225

### Estimated energy costs for this home

Estimated energy costs for this nome					
	Current energy costs	Potential energy costs	Potential future savings		
Heating	£1,557 over 3 years	£1,557 over 3 years			
Hot water	£243 over 3 years	£171 over 3 years	You could		
Lighting	£267 over 3 years	£267 over 3 years	save £72		
Tota	s £2,067	£1,995	over 3 years		

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

	Indiantive anot	Typical saving	Rating after i	mprovement
Recommended measures	Indicative cost	per year	Energy	Environment
1 Solar water heating	£4,000 - £6,000	£24	C 79	C 78
2 Solar photovoltaic panels, 2.5 kWp	£3,500 - £5,500	£304	B 87	B 86

### Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to www.greenerscotland.org.



### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

### 2 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

LZC energy sources present: There are none provided for this home

### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	9,733	N/A	N/A	N/A
Water heating (kWh per year)	1,993			

### About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst (www.elmhurstenergy.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Assessor membership number: Company name/trading name: Address:	Mr. Graham Laird EES/015039 Allied Surveyors Scotland Plc Lyle House, Pavilion 1 Fairways Business Park
	Invernesshire
	IV2 6AA
Phone number:	01463 239 494
Email address:	inverness@alliedsurveyorsscotland.com
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.





### PART 4.

## PROPERTY QUESTIONNAIRE

The owner of the property is required to complete this document which asks for information on the property such as 'Which council tax band?' etc.



Property address 24 GREAT GLEN PHACE	
INVERNESS IV38FA	
Seller(S) WILLIAM MAXWELL	ONVE MAXWELL
Completion date of property questionnaire	28th APRIL 2022

### Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

### Information to be given to prospective buyer(s)

1.	Leng	th of ow	nersh	ip							
	How	long ha	ve you	owne	ed the p	orope	rty?	24	EARS	5 MONY	°НS
2.	Coun	cil tax									
	Whick	n Counc	cil Tax	band	is your	prop	erty ir	n? (Please	e circle)		
	A	В	С	D	E	F	G	н			
3.	Parki	ng									
	What	are the	arran	geme	nts for p	oarki	ng at y	your prop	erty?		
	(Pleas	se tick a	all that	apply	()						
	•	Garag	e								
	•	Alloca	ted pa	irking	space		X	× 2.			
		Drivev	vay								
		Share	d park	ing							
	•	On str	eet								
		Reside	ent pe	rmit							
		Meter	ed par	king							
	e	Other	(pleas	e spe	cify):						
4.	Conse	ervation	area								~
	specia	r prope al archit ich it is	tectura	al or h	nistorica	al inte	erest, '	the chara	(that is a octer or a	an area of appearance	Yes(No/) Don't know

5.	Listed buildings	1
	Is your property a Listed Building, or contained within one (that is a building recognised and approved as being of special architectural or historical interest)?	Yes/No YES
6.	Alterations/additions/extensions	
а.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?	Yes/No
	If you have answered yes, please describe below the changes which you have made:	
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?	Yes/No
	If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.	NA
	If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	
).	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	Yes/No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	Yes/No N/A
	(ii) Did this work involve any changes to the window or door openings?	Yes/No NA
(	(iii) Please describe the changes made to the windows doors, or patio doors approximate dates when the work was completed):	s (with
F	Please give any guarantees which you received for this work to your solicito agent.	or or estate

7.	Central heating	
а.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property — the main living room, the bedroom(s), the hall and the bathroom).	Yes/No/ Partial YES GAS FIRED.
	If you have answered yes or partial – what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	GAS FIRED.
	If you have answered yes, please answer the three questions below:	
	i) When was your central heating system or partial central heating system installed?	DEC 2019
	(ii) Do you have a maintenance contract for the central heating system?	Yes/No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	No
	(iii) When was your maintenance agreement last renewed? (Please provide the month and year).	NA.
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes/No YES
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	Yes/No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	Yes/No
b.	Are you aware of the existence of asbestos in your property?	Yes/No (
	If you have answered yes, please give details:	NO

	Services	Connected	Supplier	
	Gas or liquid petroleum gas	$\checkmark$	BRITISH GA.	S.
	Water mains or private water supply		SCOTTISH WA	TER
	Electricity		SCOTTISHGI	75.
	Mains drainage		SCOTTISH WAT	TER
	Telephone		BT.	
	Cable TV or satellite	No.	137	
	Broadband		BT	
	here a septic tank system at ou have answered yes, pleas		questions below:	Yes/No
i) D anl	o you have appropriate cons </td <td>ents for the disch</td> <td>arge from your septic</td> <td>Yes/No/ Don't know</td>	ents for the disch	arge from your septic	Yes/No/ Don't know
уо	oo you have a maintenance c u have answered yes, please have a maintenance contrac	give details of th		Yes/No N/A

24

11.	Responsibilities for shared or common areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area? If you have answered yes, please give details:	Yes/No/ Don't know
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas? If you have answered yes, please give details:	Yes/No/ Not applicable
с.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	Yes/No NO
d.	Do you have the right to walk over any of your neighbours' property — for example to put out your rubbish bin or to maintain your boundaries? If you have answered yes, please give details:	Yes/No NO
9.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries? If you have answered yes, please give details:	Yes/No NO
	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.) If you have answered yes, please give details:	Yes/No NO
2.	Charges associated with your property	
•	Is there a factor or property manager for your property? If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges: KOSS & LIDDELL GO ST ENOCHISQUARE CLASCOM ELOO SINKING FUND (FLOAT.)	Ves/NO JES
eat (	Glen Place, Inverness, IV3 8FA 6 WINDOW CHEA FEES	VING = \$ 158=00 P D MAINT.= \$ 80=00 P \$ 140-00 PT

b	Is there a common buildings insurance policy?	
	. Is there a common buildings insurance policy?	Yes/NO/ Don't know YES
	If you have answered yes, is the cost of the insurance included i your monthly/annual factor's charges?	n Yes/No7 Don't know YES
C.	Please give details of any other charges you have to pay on a re- upkeep of common areas or repair works, for example to a resid maintenance or stair fund. MAINTENANCE OF COMMUNAL CROUND 4. EXTERIOR WINDOW GRANINS.	ents' association, or
13	. Specialist works	
а.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	Yes/No NO
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property.	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property? If you have answered yes, please give details:	Yes/No NO
с.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work? If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself <u>please</u> write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate. Guarantees are held by:	Yes/No

	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	
(iv)	National House Building Council (NHBC)	No	Yes	Don't know	With title deeds	Lost	
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	
с.	Are there any outstanding claims und If you have answered yes, please give		he guarant	ees listed a	bove?	Yes/No	
5.	Boundaries					1	
	So far as you are aware, has any boun last 10 years?	idary of yo	ur property	been mov	ed in the	Yes/	

16.	Notices that affect your property	
<del></del>	In the past three years have you ever received a notice:	
а.	advising that the owner of a neighbouring property has made a planning year application?	s/No
b.	that affects your property in some other way? Yes	s/No
C.	that requires you to do any maintenance, repairs or improvements to your Yes	No
	If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.	

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge

M. Signature(s) : Laxwell 2027 Date:

. 1