



### **Energy Performance Certificate (EPC)**

**Dwellings** 

### **Scotland**

#### 14 MAIN STREET, BALINTORE, TAIN, IV20 1UE

**Dwelling type:** Semi-detached bungalow

Date of assessment: 01 December 2025
Date of certificate: 01 December 2025

Total floor area: 70 m<sup>2</sup>

Primary Energy Indicator: 264 kWh/m²/year

**Reference number:** 9215-7022-3109-0989-7206 **Type of assessment:** RdSAP, existing dwelling

Approved Organisation: ECMK

Main heating and fuel: Boiler and radiators, wood


pellets

#### You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

Estimated energy costs for your home for 3 years*	£4,296	See your recommendations
Over 3 years you could save*	£690	report for more information

<sup>\*</sup> based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

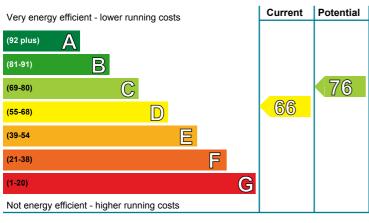


#### **Energy Efficiency Rating**

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Your current rating is **band D (66)**. The average rating for EPCs in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

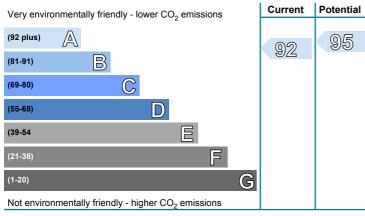

#### **Environmental Impact (CO<sub>2</sub>) Rating**

This graph shows the effect of your home on the environment in terms of carbon dioxide ( $CO_2$ ) emissions. The higher the rating, the less impact it has on the environment.

Your current rating is band A (92)

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

### Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years
1 Floor insulation (solid floor)	£5,000 - £10,000	£393.00
2 Solar water heating	£4,000 - £7,000	£171.00
3 Heat recovery system for mixer showers	£600 - £1,500	£126.00

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.

To find out more about the recommended measures and other actions you could take today to stop wasting energy and money, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE

#### Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Granite or whin, with internal insulation Solid brick, with internal insulation Timber frame, as built, insulated (assumed)	**** *****	**** ****
Roof	Pitched, insulated at rafters Roof room(s), insulated (assumed)	**** ****	**** ****
Floor	Solid, no insulation (assumed)	_	_
Windows	Fully double glazed	***	***
Main heating	Boiler and radiators, wood pellets	***	****
Main heating controls	Programmer, room thermostat and TRVs	****	<b>★★★★</b> ☆
Secondary heating	None	_	_
Hot water	From main system	***	****
Lighting	Good lighting efficiency	****	<b>★★★★</b> ☆

#### The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.

As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

### The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The calculated emissions for your home are 11 kg CO<sub>2</sub>/m<sup>2</sup>/yr.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 0.8 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 0.3 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

#### Estimated energy costs for this home

	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,958 over 3 years	£2,586 over 3 years	
Hot water	£1,194 over 3 years	£876 over 3 years	You could
Lighting	£144 over 3 years	£144 over 3 years	save £690
Tota	als £4,296	£3,606	over 3 years


These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

#### **Recommendations for improvement**

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures		Indicative cost	Typical saving	Rating after improvement	
		Indicative cost	per year	Energy	Environment
1	Floor insulation (solid floor)	£5,000 - £10,000	£131	C 69	A 93
2	Solar water heating	£4,000 - £7,000	£57	C 71	A 93
3	Heat recovery system for mixer showers	£600 - £1,500	£42	C 72	A 93
4	Solar photovoltaic panels, 2.5 kWp	£8,000 - £10,000	£196	C 76	A 95

### Choosing the right improvement package

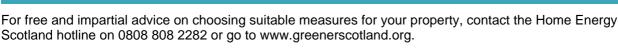



#### About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

#### 1 Floor insulation (solid floor)

Insulation of a floor will significantly reduce heat loss; this will improve levels of comfort, reduce energy use and lower fuel bills. Insulating solid floors can present challenges; insulation laid on top of existing solid floors may impact on existing doors and finishes whilst lifting of a solid floor to insert insulation below will require consideration of the potential effect on both structural stability and damp proofing. It is advised to seek advice from a Chartered Structural Engineer or a registered Architect about this if unsure. Further information about floor insulation is available from many sources including www.energysavingtrust.org.uk/scotland/Insulation/Floor-insulation. Building regulations generally apply to this work and may also require a building warrant so it is best to check with your local authority building standards department.

#### 2 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### 3 Heat recovery system for mixer showers

A shower heat recovery system extracts heat from the water in the shower drain and transfers it to incoming cold water. This reduces the amount of energy needed per shower. Building regulations generally apply to this work, so it is best to check with your local authority building standards department and seek advice from a qualified plumber or heating engineer.

#### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at www.microgenerationcertification.org.

#### Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

#### LZC energy sources present:

Biomass main heating

#### Your home's heat demand

In this section, you can see how much energy you might need to heat your home and provide hot water. These are estimates showing how an average household uses energy. These estimates may not reflect your actual energy use, which could be higher or lower. You might spend more money on heating and hot water if your house is less energy efficient. The table below shows the potential benefit of having your loft and walls insulated. Visit https://energysavingtrust.org.uk/energy-at-home for more information.

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	6,723.14	N/A	N/A	N/A
Water heating (kWh per year)	2,806.21			

#### **About this document**

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by ECMK (www.ecmk.co.uk), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting www.scottishepcregister.org.uk and entering the report reference number (RRN) printed at the top of this page.

Assessor's name: Jennifer Swanson Assessor membership number: ECMK303576

Company name/trading name: Walker Fraser Steele Address: 27 Waterloo Street

Glasgow G2 6BZ

Phone number: 01412210442

Email address: jenniferswanson@outlook.com

Related party disclosure: No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

#### Use of this energy performance information

Once lodged by your EPC assessor, this Energy Performance Certificate and Recommendations Report are available to view online at www.scottishepcregister.org.uk, with the facility to search for any single record by entering the property address. This gives everyone access to any current, valid EPC except where a property has a Green Deal Plan, in which case the report reference number (RRN) must first be provided. The energy performance data in these documents, together with other building information gathered during the assessment is held on the Scottish EPC Register and is available to authorised recipients, including organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK governments. A range of data from all assessments undertaken in Scotland is also published periodically by the Scottish Government. Further information on these matters and on Energy Performance Certificates in general, can be found at www.gov.scot/epc.

#### Advice and support to improve this property

There is support available, which could help you carry out some of the improvements recommended for this property on page 3 and stop wasting energy and money. For more information, visit greenerscotland.org or contact Home Energy Scotland on 0808 808 2282.

Home Energy Scotland's independent and expert advisors can offer free and impartial advice on all aspects of energy efficiency, renewable energy and more.

HOMEENERGYSCOTLAND.ORG
0808 808 2282
FUNDED BY THE SCOTTISH GOVERNMENT





# Single Survey

Property Address	14 Main Street Balintore Tain IV20 1UE	
Customer	Ms Lisa Clothier	
Date of Inspection	01/12/2025	
Prepared by	Jennifer Swanson Walker Fraser Steele	

#### TERMS AND CONDITIONS

#### **PART 1 - GENERAL**

#### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who will have sufficient current local knowledge of the particular market to competently survey, value and report upon Residential Property. <sup>1</sup>

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by checking the adjacent box.

V

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

#### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

Prior to 1 December 2008, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions.

The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

#### 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential Surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:

- · the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

#### 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

#### 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report will be prepared from information contained in the Report and the generic Mortgage Valuation Report.<sup>2</sup>

#### 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

#### 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

#### 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as

### Single Survey

detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

#### 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

#### 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance
  to the Purchaser towards the purchase of the Property and in whose favour a standard security
  will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format.
- the "Market Value" is the estimated amount for which a property should exchange on the date of
  valuation between a willing buyer and a willing seller in an arm's-length transaction after proper
  marketing wherein the parties had each acted knowledgeably, prudently and without compulsion
- the "Property" is the property which forms the subject of the Report:
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- "prospective Purchaser" is anyone considering buying the Property.
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

<sup>&</sup>lt;sup>1</sup>Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Codes of Conduct

<sup>&</sup>lt;sup>2</sup>Which shall be in accordance with the current RICS Valuation Standards (the Red Book) and RICS Rules of Conduct.

#### PART 2 – DESCRIPTION OF THE REPORT

#### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

#### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

#### 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

- 2.3.1 Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
- 2.3.2 Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
- 2.3.3 Category 1: No immediate action or repair is needed.

WARNING: If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

#### 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is

made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

#### 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

#### 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

#### 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the reinstatement cost, as defined below.

"Market Value" The estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

#### 1. INFORMATION AND SCOPE OF INSPECTION

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the Surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the Surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the Surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities will not be inspected or reported on.

	,
Description	The property comprises a semi-detached, one and half storey house.
Accommodation	Ground floor: Entrance Porch, Hall, Open plan Kitchen/Living room, Bathroom and Bedroom First floor: Landing and two Bedrooms
Gross internal floor area (sqm)	70m or thereby
Neighbourhood and location	The property stands to the heel of the pavement in Main Street in the seaboard village of Balintore on the east Ross-shire coast.  The property is within walking distance of shops, primary school and a range of other amenities. Enhanced facilities, including secondary school, are available in Tain some eight miles distant. A restaurant is currently being developed opposite the property.
Age	Built circa 1850 with single storey extensions to the front and rear built circa 1965 and refurbishments/alterations carried out 2021
Weather	At the time of the inspection, it was dry.
Chimney stacks	Visually inspected with the aid of binoculars where required.  There are two stone chimney stacks one of which is pointed externally with stone copes, and the other is rendered, both with cement mortar flashing.

#### **Roofing including roof space**

Sloping roofs were visually inspected with the aid of binoculars where required.

Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally. Flat roofs have a limited life and depending on their age and quality of workmanship can fail at any time.

Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defines as being from a 3m ladder within the property. If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and reasonable to do so.

Roofs are prone to water penetration in extreme storms but it is not always possible for surveyors to identify this likelihood in good or dry weather. All slated roofs in particular should be inspected and repaired by reputable tradesmen on an annual basis and especially after storms.

The main roof is pitched, timber framed, timber sarked and is metal sheeting clad with stone skews. Skylights have been let into the roof on the front and rear elevations and a timber framed, timber clad box dormer has been let into the roof over the rear elevation under a flat roof. The roof over the rear extension is mono-pitched, timber framed and metal sheeting clad.

#### Rainwater fittings

Visually inspected with the aid of binoculars where required.

Rainwater fittings are formed in plastic.

#### Main walls

Visually inspected with the aid of binoculars where required.

Foundations and concealed parts were not exposed or inspected.

The main walls are solid stone construction and rough cast on the outer face to the front elevation and rendered to the rear elevation. The rear extension walls is assumed to be single leaf concrete block construction which is roughcast on the external face.

The type of damp-proof course to the main walls cannot be ascertained.

Windows, external doors and joinery  External decorations	Internal and external doors were opened and closed where keys were available.  Random windows were opened and closed where possible. Doors and windows were not forced open.  The windows are double glazed with UPVC casements. The external door is of UPVC manufacture.  Visually inspected  The external joinery had a paint finish The walls and cills are finished in masonry paint.
Conservatories / porches	Visually inspected  The front extension Porch is assumed to be single leaf concrete block construction which is roughcast on the external face under a mono-pitched metal sheeting clad roof.
Communal areas	None
Garages and permanent outbuildings	None
Outside areas and boundaries	None
Ceilings	Visually inspected from floor level  The ceilings are timber framed and faced with plasterboard which has been taped and filled. The ceilings at first floor level are mainly coombed.
Internal walls	Visually inspected from floor level. Using a moisture meter, walls were randomly tested for dampness where considered appropriate.  The internal walls and partitions are timber framed and faced with plasterboard which has been taped and filled with the exception of one wall in the Open plan Kitchen/Living room which is exposed stonework.  Sections of internal wall in the Bathroom are timber lined to dado height. Sections of the internal wall in the Bathroom are wet wall lined.

Floors including sub floors	Surface of exposed floors were visually inspected. No carpets or floor covering were lifted.
	The floors at ground level are solid concrete construction. At first floor level the floors are suspended timber construction.
Internal joinery and kitchen fittings	Built-in cupboards were looked into but no stored items were moved.
	Kitchen units were visually inspected excluding appliances.
	Standard modern joinery has been fixed throughout and proprietary kitchen units have been fitted.
	The internal door to the bathroom is of timber design with glazed upper sections.
Chimney breasts and fireplaces	Visually inspected. No testing of the flues or fittings was carried out.
	The chimney breast is formed in stone and faced with plasterboard at first floor level, at ground floor level the chimney breast is exposed stonework. The fireplace in the Open plan Kitchen/Living room is exposed stonework. The wood pellet stove boiler sits in a flag hearth.
Internal decorations	Visually inspected
	The walls and ceilings are finished in emulsion. The internal joinery has a paint finish.
Cellars	None
Conars	None
Electricity	Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the Surveyor will state that in the report and will not turn them on.
	Mains grid supplied electricity. The visible cabling is PVC sheathed and 13 Amp power points have been fitted. The consumer unit is located at high level in the Hall and the meter is located within a hatch at the eaves of a first floor Bedroom.
Gas	None

Water, plumbing and bathroom fittings	Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.  No tests whatsoever were carried out to the system or appliances.  Mains supply water. The distribution pipes are in copper and PVC. Ceramic sanitary fittings have  been fixed. The hot water cylinder is located in a first floor bedroom hatch. A stop cock is located within a small hatch in the Bathroom.
Heating and hot water	Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.  No tests whatsoever were carried out to the system or appliances.  Central heating is provided by a wood pellet boiler stove to wall mounted radiators. Hot water is provided from the same source. The stove is located in the Open plan Kitchen/Living space.
Drainage	Drainage covers etc were not lifted. Neither drains nor drainage system were tested.  Drainage is assumed to connect into the public sewer.
Fire, smoke and burglar alarms	Visually inspected.  No tests whatsoever were carried out to the system or appliances.  Smoke detectors, a heat detector and a carbon monoxide detector have been fitted through the property.

## Any additional limits to inspection

Not all roof coverings were clearly visible due to the height/configuration of the roof and the layout of the site.

The floors were close covered and a detailed inspection of the floor was not possible.

The inspection of the roof timbers was restricted due to insulation laid at the rafters. Access was via hatches at eaves in the first floor Bedrooms.

The inspection of some areas of internal walls and moisture meter testing was restricted in part due to furniture placement and the storage of personal belongings.

In areas where no inspection was possible, the surveyor has assumed there are no defects that

have a material effect on the valuation.

There is a possibility that asbestos may be present within components and fittings of properties built prior to the year 2000. It is impossible to positively identify asbestos without a test. It is beyond the scope of this inspection to test for asbestos and future occupants should be advised that if they have any concerns then they should ask a specialist to undertake an appropriate test.

We have not made checks to ascertain whether the property lies within a Radon area. Further advice can be sought from the National Radiological Protection Board.


No checks have been made with regard to flood risk.

An inspection for Japanese Knotweed was not carried out. This is a plant which is subject to control regulation, is considered to be invasive and one which can render a property unsuitable for some mortgage lenders. It is therefore assumed that there is no Japanese Knotweed within the boundaries of the property or its neighbouring property. Identification of Japanese Knotweed is best undertaken by a specialist contractor. If it exists removal must be undertaken in a controlled

manner by specialist contractors. This can prove to be expensive.

Normal maintenance is not treated as a repair for the purposes of the Single Survey. When a category 1 rating is provided this means the property must continue to be maintained in the normal way.


### Sectional Diagram showing elements of a typical house

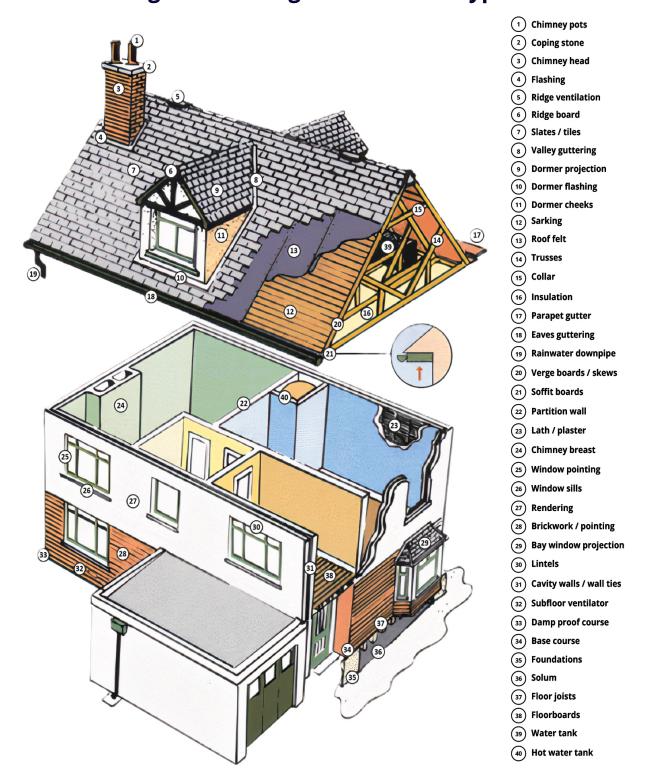

Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.

#### 2. CONDITION

This section identifies problems and tells you about the urgency of any repairs by using one of the following 3 categories:

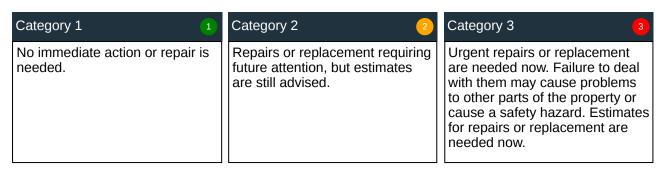

Structural movement	
Repair category:	1
Notes	Evidence of previous movement was noted in the form of cracking to roughcast to the front elevation of the Porch and above the front window of the Open plan Kitchen/Living room and to the rear elevation of the rear extension at the join with the neighbouring property but, within the limitations of my inspection, there was no evidence that the movement was recent or serious. Further significant movement would seem unlikely although on the basis of a single inspection cannot be positively excluded.

Dampness, rot and infestation	
Repair category:	1
Notes	Damp meter readings were taken where considered appropriate within the property and moisture levels were found to be within an acceptable range.

Chimney stacks	
Repair category:	1
Notes	Our inspection of chimneys was limited but they are of an age and style where a degree of regular ongoing maintenance should be anticipated. Wear and tear was noted to chimney copes.

Roofing including roof space	
Repair category:	1
Notes	Sections of sheeting appear uneven with small gaps present.
	Minor pointing defects noted to stone skew pointing.
	Roofing contractors recommend that roof coverings are inspected regularly in order to ensure they remain watertight.

Rainwater fittings	
Repair category:	1
Notes	The gutters are uneven in some sections.  We would highlight that it was not raining at the time of our inspection and we would recommend that all rainwater fittings be inspected during heavy rainfall in order to ensure they are free from defect.

Main walls	
Repair category:	1
Notes	As previously mentioned that is cracked roughcast to some elevations. Elsewhere the walls show signs of normal wear and tear commensurate with age and style. The property must be regularly maintained to avoid further deterioration.

Windows, external doors and joinery	
Repair category:	1
Notes	Windows were not all fully opened or tested and it should be appreciated that some defects are only evident during certain weather conditions. Within the limitations of our inspection, no significant defects were noted.

External decorations	
Repair category:	1
Notes	There are no obvious or significant defects affecting external decorations. Paint finished and decorated external surfaces will require redecoration on a regular basis.

Conservatories / por	ches
Repair category:	1
Notes	There is a small patch of missing roughcast. It is understood from the selle that this will be remedied prior to sale. Checks should be made to verify this
	As previously mentioned that is cracked roughcast to the front elevation of the Porch. The property must be regularly maintained to avoid further deterioration.
Communal areas	
Repair category:	
Notes	Not Applicable
Garages and permar	nent outbuildings
Repair category:	
Notes	Not Applicable
Outside areas and b	oundaries
Repair category:	
Notes	Not Applicable
Ceilings	
Repair category:	1
Notes	There are no obvious or significant defects affecting ceilings.
Internal walls	
Repair category:	1
Notes	There are no obvious or significant defects affecting the internal walls.

Floors including sub floors	
Repair category:	1
Notes	There are no obvious or significant defects affecting flooring.

Internal joinery and kitchen fittings	
Repair category:	1
Notes	Internal glazing to the Bathroom door should be checked for safety glass.

Chimney breast and fire places	
Repair category:	1
Notes	The fireplace is in reasonable condition and appears to be free from significant defect. It should be ensured that all flues, whether in use or not, are kept in a sound condition and are regularly checked and serviced. Flues which are in use would benefit from a regular smoke test.  It is assumed that a historic fireplace in the ground floor Bedroom has been sealed. All disused flues should be capped and vented.

Internal decorations	
Repair category:	1
Notes	There are minor blemishes to internal decorations.

Cellars	
Repair category:	
Notes	Not Applicable

Electricity	
Repair category:	1
Notes	The wiring system would appear to have been upgraded within recent years and is along modern lines. It will be appreciated that the system was not checked or tested and it is assumed that all works were carried out by a registered electrical contractor to current regulations. This should be confirmed.  It is recommended that all electrical installations be checked every five years or on change of ownership to keep up to date with frequent changes in Safety Regulations. Further advice will be available from a qualified NICEIC / SELECT registered Contractor. It should be appreciated that only recently constructed or rewired properties will have installations which fully comply with IEE regulations.

Gas	
Repair category:	
Notes	Not Applicable

Water, plumbing and bathroom fittings				
Repair category:	1			
Notes	There are no obvious defects affecting the visible plumbing apparatus.  There are no obvious reportable defects affecting sanitary ware.  No tests have been undertaken of the system, however within the limitations of our inspection, no significant defects were noted.			

Heating and hot water					
Repair category:	1				
Notes	At the time of inspection the heating system was in use and appeared to be functioning in an acceptable fashion, although this should be confirmed by a suitably qualified contractor.				
	It is assumed that the central heating system has been properly installed, updated and maintained to meet with all current regulations and standards with particular regard to fluing and ventilation requirements.				

Drainage	
Repair category:	1
Notes	There are no obvious defects affecting the foul or surface water drainage systems.  Systems not tested. Underground drainage and manholes were not inspected. A limited surface visual inspection found no reportable items of disrepair.

### Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the comments above for detailed information.

Structural movement	Category 1
Dampness, rot and infestation	No immediate action or repair is needed.
Chimney stacks	1
Roofing including roof space	Category 2  Repairs or replacement requiring future
Rainwater fittings	attention, but estimates are still advised.
Main walls	1
Windows, external doors and joinery	Category 3 Urgent repairs or replacement are
External decorations	needed now. Failure to deal with them
Conservatories / porches	may cause problems to other parts of the property or cause a safety hazard
Communal areas	Estimates for repairs or replacement are needed now.
Garages and permanent outbuildings	
Outside areas and boundaries	
Ceilings	1
Internal walls	1
Floors including sub floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	
Electricity	1
Gas	
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

#### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

#### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

#### 3. ACCESSIBILITY INFORMATION

#### **Guidance Notes on Accessibility Information**

#### Three steps or fewer to a main entrance door of the property

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

#### **Unrestricted parking within 25 metres**

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes
3. Is there a lift to the main entrance door of the property?	No
4. Are all door openings greater than 750mm?	No
5. Is there a toilet on the same level as the living room and kitchen?	Yes
6. Is there a toilet on the same level as a bedroom?	Yes
7. Are all rooms on the same level with no internal steps or stairs?	No
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes

#### 4. VALUATION AND CONVEYANCER ISSUES

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated re-instatement cost for insurance purposes.

#### Matters for a solicitor or licensed conveyancer

It is assumed that a Property Enquiry Certificate will be exhibited and that the property has a clear Title.

The exact extent of the boundaries should be confirmed by the Title Deeds.

In respect of any mutual boundaries, any shared maintenance liabilities or responsibilities require verification.

It is assumed the rear of the property is accessed by a right of way over neighbouring land. Confirm the ownership and rights of access. The valuation assumes that there are no onerous restrictions or liabilities.

There are two single storey extensions (circa 1965) and the property has been altered (2021), the valuation assumes that all necessary Local Authority and other consents have been obtained for alterations and appropriate documentation, including building warrants and completion certificates issued. If any works did not require consent it is assumed that they meet the building standards required by the building regulations or are exempt.

Where defects or repairs have been identified within this report it is recommended that, prior to entering into any legally binding sale or purchase contract, further specialists or contractors advice and estimates should be obtained, to establish the implications, if any, on a potential offer to purchase or the sale price likely to be achieved for the property.

The Solicitor/Conveyancer must ensure that any prospective purchaser fully understands the nature, criteria and basis of a Home Report and in particular what a Home Report is and what it is not (an exhaustive Condition Report) This should be done before any prospective purchaser makes an offer for this property based on the content of this report. If the Solicitor or purchaser requires any clarification in relation to this they must contact the surveyor or familiarise themselves with the nature and criteria of this type of report.

#### Estimated re-instatement cost (£) for insurance purposes

THREE HUNDRED THOUSAND POUNDS (£300,000)

#### Valuation (£) and market comments

ONE HUNDRED AND THIRTY THOUSAND POUNDS (£130,000)

# Single Survey

Report author:	Jennifer Swanson	
Company:	Walker Fraser Steele	
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ	
Electronically Signed By:	Jennifer Swanson	
Date of report:	02/12/2025	



(i) Case Details									
Seller name(s):		Ms L Clothier							
Address line 1:		14 Main Street							
Address line 2:		Balintore							
Address line 3:	Address line 3:								
Town / City:	Tain		Cou	unty:					
Postcode:		IV20 1UE	V20 1UE						
Date of inspection (dd/mm/yyyy):		01/12/2025	01/12/2025						
♠ Property Details									
Property type:		House							
Property style:		Semi-Detached							
Was the property built for the public	sector?	No No							
117									
Elect of property	Number of floo	Specific details for	: flats 8	& maisonettes  Number of units in block:			Lift available in	a blook?	
Floor of property:	Number of floo	ors in block.		Number of units in block.			Liit avallable ii	1 DIOCK?	
Tenure									
Tenure:		Absolute Ownership	)						
		If Lea	sehold	l:					
Unexpired term (years):			Gro	ound rent (pa):	1	€			
Acommodation									
No. of living room(s):	1 N	lo. of bedroom(s):		3	No.	of kitchen(s):			1
No. of bathroom(s):	1 N	lo. of WC(s):		0	No.	of other room(s)	:		0
Description of other room(s):									
Floor area (m²):	88	3	Floor are				External		
Garages & Outbuildings									
Garages / Parking space(s):		None							
Permanent outbuildings:		None.							
Construction									
Wall construction:		Solid Stone							
Roof construction:	Metal Sheeting								
Approximate year of construction:		1850							
Any evidence of alterations or extensions?		Yes							
Alterations or extension details:		front extension and	interr	Itered / extended with nal layout alternations necessary consents.	s. Ou	r valuation a	assumes the	on, single ese works	storey have

⚠ Risks								
Is there any evidence of movement to the property?		Yes	Yes					
If yes, does this appear longstanding	g?	Yes	Yes					
Are there any further risk factors?		No	No					
If yes, please provide details:		Evidence of movements to be longstanding a	ent was noted in the nd non-progressive.	form of minor cracking	g to roughcast. This is believed			
<b>₹</b> Services								
Electricity:	Mains	Gas:	None	Water:	Mains			
Central heating:	Full		Drainage:	Mains				
Provide comments:	Biomass pellet fired	stove						
Legal Matters								
Are there any apparent legal issues	to be verified by the conveya	ancer? Yes						
If yes, please provide details:	affected.	Soliveyaneer should obta	iii detaiis. Odi valda	and assumes that the	property is not adversely			
• Location								
Location details:	The property is situa	ited within a mainly resid	ential area with an a	average level of local a	amenities.			
Roads								
Road description:	The road has been a	adopted.						
General Remarks								

Essential Repairs
None
<u>₿</u> Mortgageability Remarks
The property is adjacent to a restaurant. The proximity of the commercial premises may deter some purchasers and affect marketability. This is reflected in the mortgage valuation.

Mortgageability Remarks
The property is adjacent to a restaurant. The proximity of the commercial premises may deter some purchasers and affect marketability. This is reflected in the mortgage valuation.  There are areas of single skin masonry or insubstantial material which may not comply with some lender requirements.  The property forms suitable security for mortgage purposes subject to the specific lending criteria of any mortgage provider.
∀aluation

Market value in present condition:	£ 130000
Market value after essential repairs:	£
Insurance reinstatement value:	£ 300000
Retention required? No Retention amount:	£
Declaration	
Surveyor name:	Jennifer Swanson
Surveyor qualifications:	MRICS
Report date (dd/mm/yyyy):	01/12/2025
Company name:	Walker Fraser Steele
Address:	First Floor, Suite 1/3, Cadell House 27 Waterloo Street Glasgow G2 6BZ
Telephone number:	01412210442
Email address:	enquiries@walkerfrasersteele.co.uk
Surveyor signature:	



Property address	14 MAIN STREET, BALINTORE, TAIN, IV20 1UE
Seller(s)	Mr Jonathan Clothier Mrs Lisa Clothier
Completion date of property questionnaire	21st November 2025

### **Note for sellers**

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

### Information to be given to prospective buyer(s)

1.	Length of ownership
	How long have you owned the property? February 2025
2.	Council tax
	Which Council Tax band is your property in? (Please circle)
	(A) B C D E F G H
3.	Parking
	What are the arrangements for parking at your property?
	(Please tick all that apply)
	• Garage
	Allocated parking space
	Driveway
	Shared parking
	● On street
	Resident permit
	Metered parking
	Other (please specify):
4.	Conservation area
	Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?  Yes / No / Don't know desirable to preserve or enhance)?

5.	Listed buildings	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<del>Yes</del> / No
6.	Alterations/additions/extensions	
a.	(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?  If you have answered yes, please describe below the changes which you have made:	<del>Yes</del> / No
	(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?  If you have answered yes, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.  If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:	<del>Yes</del> / <del>Ne</del>
b.	Have you had replacement windows, doors, patio doors or double glazing installed in your property?	<del>Yes</del> / No
	If you have answered yes, please answer the three questions below:	
	(i) Were the replacements the same shape and type as the ones you replaced?	<del>Yes</del> / <del>No</del>
	(ii) Did this work involve any changes to the window or door openings?	Yes / No
	(iii) Please describe the changes made to the windows, doors or patio doors (v dates when the work was completed):	vith approximate
	Please give any guarantees which you received for this work to your solicitor or e	estate agent.

	Central heating	
a.	Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).	Yes / <del>Ne</del> / <del>Partial</del>
	If you have answered yes / partial - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).	
	Wood Pellet boiler stove to wall mounted radiators	
	If you have answered yes, please answer the three questions below:	
b.	When was your central heating system or partial central heating system installed?	2021
c.	Do you have a maintenance contract for the central heating system?	<del>Yes</del> / No
	If you have answered yes, please give details of the company with which you have a maintenance contract:	
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
8.	Energy Performance Certificate	
	Does your property have an Energy Performance Certificate which is less than 10 years old?	Yes / <del>No</del>
9.	Issues that may have affected your property	
a.	Has there been any storm, flood, fire or other structural damage to your property while you have owned it?	<del>Yes</del> / No
	If you have answered yes, is the damage the subject of any outstanding insurance claim?	<del>Yos</del> / <del>No</del>
b.	Are you aware of the existence of asbestos in your property?	<del>Yes</del> / No
	If you have answered yes, please give details:	

10.	Service	<b>2</b> S					
a.	Please tick which services are connected to your property and give details of the supplier:						
		Gas / liquid petroleum gas	_				
		Water mains / private water supply	✓	Mains supply			
		Electricity	✓	Mains grid supply -Octopus			
		Mains drainage	✓	Highland Council			
		Telephone	_				
		Cable TV / satellite	_				
		Broadband	✓	Highland broadband			
				Ţ			
b.		e a septic tank system at you		uestions below:	<del>Yes</del> / No		
C.	(i) Do y	ou have appropriate conse	nts for the discha	rge from your septic tank?	Yes / No / Den't know		
d.	(ii) Do y	ou have a maintenance co	ntract for your se	ptic tank?	Yes / No		
	If you I have a	nave answered yes, please maintenance contract:	e give details of the	ne company with which you			

11.	Responsibilities for Shared or Common Areas	
a.	Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?	<del>Yes</del> / No / <del>Den't Knew</del>
	If you have answered yes, please give details:	
b.	Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?	<del>Yes</del> / No / <del>Not applicable</del>
	If you have answered yes, please give details:	
c.	Has there been any major repair or replacement of any part of the roof during the time you have owned the property?	<del>Yes</del> / No
d.	Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?	Yes / <del>No</del>
	If you have answered yes, please give details:	
	Rear property path access (no land owned )	
e.	As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?	<del>Yes</del> / No
	If you have answered yes, please give details:	
f.	As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)	<del>Yes</del> / No
	If you have answered yes, please give details:	
12.	Charges associated with your property	
a.	Is there a factor or property manager for your property?	<del>Yes</del> / No
	If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:	

b.	Is there a common buildings insurance policy?	<del>Yos</del> / No /
	If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?	Yes / No / Den't Knew
C.	Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.	
13.	Specialist works	
a.	As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?	<del>Yes</del> / No
	If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:	
b.	As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?	<del>Yos</del> / No
	If you have answered yes, please give details:	
C.	If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?	Yes / No
	If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.	
	Guarantees are held by:	

14.	Guarantees						
a.	Are there any guarantees or warranties for any of the following:						
(i)	Electrical work	No	Yos	Don't know	With title doods	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yos	Don't know	With title deeds	Lost	Cannot Answor*
(iv)	NHBC	No	Yos	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title doods	Lost	Cannot Answer*
b.	If you have answered 'yes' or 'with title deed or installations to which the guarantee(s) rela	ls', pleas te(s):	e give de	etails of t	he work		
c.	Are there any outstanding claims under any of the guarantees listed above?  If you have answered yes, please give details:					Yes	-/ <del>No</del>
15.	Boundaries						
	So far as you are aware, has any boundary o last 10 years?  If you have answered yes, please give details		operty be	een move	ed in the		/ No / t know

16.	Notices that affect your property	
	In the past 3 years have you ever received a notice:	
a.	advising that the owner of a neighbouring property has made a planning application?	Yes / No / Den't know
b.	that affects your property in some other way?	<del>Yes</del> / No / <del>Don't know</del>
C.	that requires you to do any maintenance, repairs or improvements to your property?	<del>Yes</del> / No / <del>Den't knew</del>
	If you have answered yes to any of a-c above, please give the notices to your so agent, including any notices which arrive at any time before the date of entry of t your property.	olicitor or estate he purchaser of

Declaration by the seller(s)/or other authorised body or person(s)

I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.

Signature(s):			
Date:			



# Walker Fraser Steele Chartered Surveyors

For further information, please call 0141 221 0442 or email enquiries@walkerfrasersteele.co.uk

Walker Fraser Steele First Floor Suite 1/3 Cadell House 27 Waterloo Street Glasgow G2 6BZ